



# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 2 of 13

Section 2 - HAZARDS IDENTIFICATION

## RISK

- Causes burns.
- Risk of serious damage to eyes.
- Inhalation may produce health damage\*.
- Cumulative effects may result following exposure\*.
- Limited evidence of a carcinogenic effect\*.
- Possible respiratory and skin sensitiser\*.

\* (limited evidence).

## SAFETY

- Keep locked up.
- Do not breathe dust.
- Avoid contact with eyes.
- Wear suitable protective clothing.
- Use only in well ventilated areas.
- Keep container in a well ventilated place.
- To clean the floor and all objects contaminated by this material use water and detergent.
- Take off immediately all contaminated clothing.
- In case of accident or if you feel unwell IMMEDIATELY contact Doctor or Poisons Information Centre (show label if possible).

## Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

NAME	CAS RN	%
portland cement	65997-15-1	>60
fillers, not regulated		balance

## Section 4 - FIRST AID MEASURES

### SWALLOWED

- For advice, contact a Poisons Information Centre or a doctor at once.
- Urgent hospital treatment is likely to be needed.
- If swallowed do NOT induce vomiting.
- If vomiting occurs, lean patient forward or place on left side (head-down position, if possible) to maintain open airway and prevent aspiration.
- Observe the patient carefully.
- Never give liquid to a person showing signs of being sleepy or with reduced awareness; i.e. becoming unconscious.
- Give water to rinse out mouth, then provide liquid slowly and as much as casualty can comfortably drink.
- Transport to hospital or doctor without delay.

### EYE

- If this product comes in contact with the eyes:
- Immediately hold eyelids apart and flush the eye continuously with running water.
- Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
- Continue flushing until advised to stop by the Poisons Information Centre or a doctor, or for at least 15 minutes.
- Transport to hospital or doctor without delay.
- Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

### SKIN

- If skin or hair contact occurs:

continued...

# MAPEI KERACRETE POWDER

## Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 3 of 13

Section 4 - FIRST AID MEASURES

---

- Immediately flush body and clothes with large amounts of water, using safety shower if available.
- Quickly remove all contaminated clothing, including footwear.
- Wash skin and hair with running water. Continue flushing with water until advised to stop by the Poisons Information Centre.
- Transport to hospital, or doctor.

### INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor, without delay.

### NOTES TO PHYSICIAN

- For acute or short-term repeated exposures to highly alkaline materials:
  - Respiratory stress is uncommon but present occasionally because of soft tissue edema.
  - Unless endotracheal intubation can be accomplished under direct vision, cricothyroidotomy or tracheotomy may be necessary.
  - Oxygen is given as indicated.
  - The presence of shock suggests perforation and mandates an intravenous line and fluid administration.
  - Damage due to alkaline corrosives occurs by liquefaction necrosis whereby the saponification of fats and solubilisation of proteins allow deep penetration into the tissue.

Alkalis continue to cause damage after exposure.

#### INGESTION:

- Milk and water are the preferred diluents
- No more than 2 glasses of water should be given to an adult.
- Neutralising agents should never be given since exothermic heat reaction may compound injury.
  - \* Catharsis and emesis are absolutely contra-indicated.
  - \* Activated charcoal does not absorb alkali.
  - \* Gastric lavage should not be used.

Supportive care involves the following:

- Withhold oral feedings initially.
- If endoscopy confirms transmucosal injury start steroids only within the first 48 hours.
- Carefully evaluate the amount of tissue necrosis before assessing the need for surgical intervention.
- Patients should be instructed to seek medical attention whenever they develop difficulty in swallowing (dysphagia).

#### SKIN AND EYE:

- Injury should be irrigated for 20-30 minutes.
- Eye injuries require saline. [Ellenhorn & Barceloux: Medical Toxicology].
- 

## Section 5 - FIRE FIGHTING MEASURES

---

### EXTINGUISHING MEDIA

- Foam.
- Dry chemical powder.
- BCF (where regulations permit).
- Carbon dioxide.
- Water spray or fog - Large fires only.

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 4 of 13

Section 5 - FIRE FIGHTING MEASURES

## FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves.
- Prevent, by any means available, spillage from entering drains or water courses.
- Use water delivered as a fine spray to control fire and cool adjacent area.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

## FIRE/EXPLOSION HAZARD

- Combustible solid which burns but propagates flame with difficulty; it is estimated that most organic dusts are combustible (circa 70%) - according to the circumstances under which the combustion process occurs, such materials may cause fires and / or dust explosions.
- Avoid generating dust, particularly clouds of dust in a confined or unventilated space as dusts may form an explosive mixture with air, and any source of ignition, i.e. flame or spark, will cause fire or explosion. Dust clouds generated by the fine grinding of the solid are a particular hazard; accumulations of fine dust (420 micron or less) may burn rapidly and fiercely if ignited - particles exceeding this limit will generally not form flammable dust clouds.; once initiated, however, larger particles up to 1400 microns diameter will contribute to the propagation of an explosion.
- In the same way as gases and vapours, dusts in the form of a cloud are only ignitable over a range of concentrations; in principle, the concepts of lower explosive limit (LEL) and upper explosive limit (UEL).are applicable to dust clouds but only the LEL is of practical use; - this is because of the inherent difficulty of achieving homogeneous dust clouds at high temperatures (for dusts the LEL is often called the "Minimum Explosible Concentration", MEC)
- A dust explosion may release of large quantities of gaseous products; this in turn creates a subsequent pressure rise of explosive force capable of damaging plant and buildings and injuring people.
- Usually the initial or primary explosion takes place in a confined space such as plant or machinery, and can be of sufficient force to damage or rupture the plant. If the shock wave from the primary explosion enters the surrounding area, it will disturb any settled dust layers, forming a second dust cloud, and often initiate a much larger secondary explosion. All large scale explosions have resulted from chain reactions of this type.
- Dry dust can be charged electrostatically by turbulence, pneumatic transport, pouring, in exhaust ducts and during transport.
- Build-up of electrostatic charge may be prevented by bonding and grounding.
- Powder handling equipment such as dust collectors, dryers and mills may require additional protection measures such as explosion venting.
- All movable parts coming in contact with this material should have a speed of less than 1-meter/sec
- A sudden release of statically charged materials from storage or process equipment, particularly at elevated temperatures and/ or pressure, may result in ignition especially in the absence of an apparent ignition source
- One important effect of the particulate nature of powders is that the surface area and surface structure (and often moisture content) can vary widely from sample to sample, depending of how the powder was manufactured and handled; this means that it is virtually impossible to use flammability data published in the literature for dusts (in contrast to that published for gases and vapours).
- Autoignition temperatures are often quoted for dust clouds (minimum ignition temperature (MIT)) and dust layers (layer ignition temperature (LIT)); LIT generally falls as the thickness of the layer increases.

Combustion products include: metal oxides.

May emit poisonous fumes.

May emit corrosive fumes.

## FIRE INCOMPATIBILITY

- None known.

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet  
Issue Date: 29-Jan-2010  
NC317TCP

CHEMWATCH 5044-43  
Version No:3  
CD 2010/1 Page 5 of 13  
Section 5 - FIRE FIGHTING MEASURES

---

## HAZCHEM

None

## Personal Protective Equipment

Gas tight chemical resistant suit.

---

## Section 6 - ACCIDENTAL RELEASE MEASURES

---

### MINOR SPILLS

- Remove all ignition sources.
- Clean up all spills immediately.
- Avoid contact with skin and eyes.
- Control personal contact by using protective equipment.
- Use dry clean up procedures and avoid generating dust.
- Place in a suitable, labelled container for waste disposal.

### MAJOR SPILLS

- Moderate hazard.
- CAUTION: Advise personnel in area.
- Alert Emergency Services and tell them location and nature of hazard.
- Control personal contact by wearing protective clothing.
- Prevent, by any means available, spillage from entering drains or water courses.
- Recover product wherever possible.
- IF DRY: Use dry clean up procedures and avoid generating dust. Collect residues and place in sealed plastic bags or other containers for disposal. IF WET: Vacuum/shovel up and place in labelled containers for disposal.
- ALWAYS: Wash area down with large amounts of water and prevent runoff into drains.
- If contamination of drains or waterways occurs, advise Emergency Services.

**Personal Protective Equipment advice is contained in Section 8 of the MSDS.**

---

## Section 7 - HANDLING AND STORAGE

---

### PROCEDURE FOR HANDLING

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Prevent concentration in hollows and sumps.
- DO NOT enter confined spaces until atmosphere has been checked.
- DO NOT allow material to contact humans, exposed food or food utensils.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately. Launder contaminated clothing before re-use.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 6 of 13

Section 7 - HANDLING AND STORAGE

## SUITABLE CONTAINER

- Polyethylene or polypropylene container.
- Check all containers are clearly labelled and free from leaks.

## STORAGE INCOMPATIBILITY

- None known.

## STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- Store in a cool, dry area protected from environmental extremes.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations

For major quantities:

- Consider storage in bunded areas - ensure storage areas are isolated from sources of community water (including stormwater, ground water, lakes and streams).
- Ensure that accidental discharge to air or water is the subject of a contingency disaster management plan; this may require consultation with local authorities.

## SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



+: May be stored together

O: May be stored together with specific preventions

X: Must not be stored together

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

### EXPOSURE CONTROLS

Source	Material	TWA mg/m <sup>3</sup>	Notes
Australia Exposure Standards	portland cement (Portland cement (a))	10	(see Chapter 14)

### EMERGENCY EXPOSURE LIMITS

Material	Revised IDLH Value (mg/m <sup>3</sup> )	Revised IDLH Value (ppm)
portland cement	5,000	

### MATERIAL DATA

MAPEI KERACRETE POWDER:

- None assigned. Refer to individual constituents.

PORTLAND CEMENT:

- for calcium silicate:  
containing no asbestos and <1% crystalline silica  
ES TWA: 10 mg/m<sup>3</sup> inspirable dust

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 7 of 13

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

TLV TWA: 10 mg/m<sup>3</sup> total dust (synthetic nonfibrous) A4

Although in vitro studies indicate that calcium silicate is more toxic than substances described as "nuisance dusts" is thought that adverse health effects which might occur following exposure to 10-20 mg/m<sup>3</sup> are likely to be minimal. The TLV-TWA is thought to be protective against the physical risk of eye and upper respiratory tract irritation in workers and to prevent interference with vision and deposition of particulate in the eyes, ears, nose and mouth.

For calcium oxide:




The TLV-TWA is thought to be protective against undue irritation and is analogous to that recommended for sodium hydroxide.

The concentration of dust, for application of respirable dust limits, is to be determined from the fraction that penetrates a separator whose size collection efficiency is described by a cumulative log-normal function with a median aerodynamic diameter of 4.0 µm (+-) 0.3 µm and with a geometric standard deviation of 1.5 µm (+-) 0.1 µm, i.e. generally less than 5 µm.

NOTE: This substance has been classified by the ACGIH as A4 NOT classifiable as causing Cancer in humans.

Portland cement is considered to be a nuisance dust that does not cause fibrosis and has little potential to induce adverse effects on the lung.

### PERSONAL PROTECTION

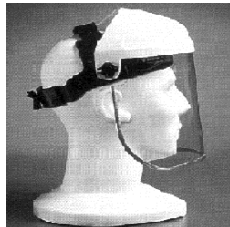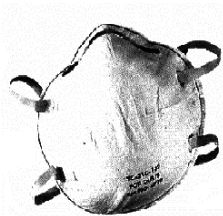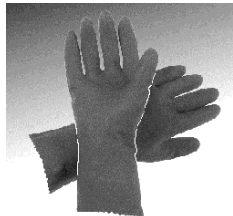

### EYE

- Safety glasses with unperforated side shields may be used where continuous eye protection is desirable, as in laboratories; spectacles are not sufficient where complete eye protection is needed such as when handling bulk-quantities, where there is a danger of splashing, or if the material may be under pressure
- Chemical goggles whenever there is a danger of the material coming in contact with the eyes; goggles must be properly fitted
- Full face shield (20 cm, 8 in minimum) may be required for supplementary but never for primary protection of eyes; these afford face protection.
- Alternatively a gas mask may replace splash goggles and face shields.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59].

### HANDS/FEET

- Elbow length PVC gloves.

NOTE:

- The material may produce skin sensitisation in predisposed individuals. Care must be taken, when removing gloves and other protective equipment, to avoid all possible skin contact.
- Contaminated leather items, such as shoes, belts and watch-bands should be removed and destroyed.

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 8 of 13

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

### OTHER

- Overalls.
- P.V.C. apron.
- Barrier cream.
- Skin cleansing cream.
- Eye wash unit.

### RESPIRATOR

Protection Factor	Half- Face Respirator	Full- Face Respirator	Powered Air Respirator
10 x ES	P1 Air- line*	- -	PAPR- P1 -
50 x ES	Air- line**	P2	PAPR- P2
100 x ES	-	P3	-
		Air- line*	-
100+ x ES	-	Air- line**	PAPR- P3

\* - Negative pressure demand

\*\* - Continuous flow.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

### ENGINEERING CONTROLS

- Local exhaust ventilation is required where solids are handled as powders or crystals; even when particulates are relatively large, a certain proportion will be powdered by mutual friction.
- Exhaust ventilation should be designed to prevent accumulation and recirculation of particulates in the workplace.
- If in spite of local exhaust an adverse concentration of the substance in air could occur, respiratory protection should be considered. Such protection might consist of:
  - (a): particle dust respirators, if necessary, combined with an absorption cartridge;
  - (b): filter respirators with absorption cartridge or canister of the right type;
  - (c): fresh-air hoods or masks
- Build-up of electrostatic charge on the dust particle, may be prevented by bonding and grounding.
- Powder handling equipment such as dust collectors, dryers and mills may require additional protection measures such as explosion venting.

Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to efficiently remove the contaminant.

#### Type of Contaminant:

direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion)  
grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion).

#### Air Speed:

1- 2.5 m/s (200- 500 f/min.)

2.5- 10 m/s (500- 2000 f/min.)

Within each range the appropriate value depends on:

Lower end of the range

Upper end of the range

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 9 of 13

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

1: Room air currents minimal or favourable to capture  
2: Contaminants of low toxicity or of nuisance value only  
3: Intermittent, low production.  
4: Large hood or large air mass in motion

1: Disturbing room air currents  
2: Contaminants of high toxicity  
3: High production, heavy use  
4: Small hood- local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 4-10 m/s (800-2000 f/min) for extraction of crusher dusts generated from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

2 metre

## Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

### APPEARANCE

Grey or white powder with an slight odour typical of cement; partly soluble in water.

### PHYSICAL PROPERTIES

Solid.  
Does not mix with water.  
Alkaline.

State	Divided solid	Molecular Weight	Not applicable
Melting Range (°C)	Not applicable	Viscosity	Not available
Boiling Range (°C)	Not applicable	Solubility in water (g/L)	Partly miscible
Flash Point (°C)	Non Flammable	pH (1% solution)	12.5 (10%)
Decomposition Temp (°C)	Not available	pH (as supplied)	13
Autoignition Temp (°C)	Not applicable	Vapour Pressure (kPa)	Not applicable
Upper Explosive Limit (%)	Not applicable	Specific Gravity (water=1)	Not available
Lower Explosive Limit (%)	Not applicable	Relative Vapour Density (air=1)	Not applicable
Volatile Component (%vol)	Not available	Evaporation Rate	Not available

## Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION

### CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

*For incompatible materials - refer to Section 7 - Handling and Storage.*

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet  
Issue Date: 29-Jan-2010  
NC317TCP

CHEMWATCH 5044-43  
Version No:3  
CD 2010/1 Page 10 of 13

---

## Section 11 - TOXICOLOGICAL INFORMATION

---

### POTENTIAL HEALTH EFFECTS

#### ACUTE HEALTH EFFECTS

##### SWALLOWED

■ The material can produce severe chemical burns within the oral cavity and gastrointestinal tract following ingestion.

The material has NOT been classified by EC Directives or other classification systems as "harmful by ingestion". This is because of the lack of corroborating animal or human evidence. The material may still be damaging to the health of the individual, following ingestion, especially where pre-existing organ (eg. liver, kidney) damage is evident. Present definitions of harmful or toxic substances are generally based on doses producing mortality rather than those producing morbidity (disease, ill-health). Gastrointestinal tract discomfort may produce nausea and vomiting. In an occupational setting however, ingestion of insignificant quantities is not thought to be cause for concern.

##### EYE

■ The material can produce severe chemical burns to the eye following direct contact. Vapours or mists may be extremely irritating.

If applied to the eyes, this material causes severe eye damage.

##### SKIN

■ The material can produce severe chemical burns following direct contact with the skin.

Skin contact is not thought to have harmful health effects (as classified under EC Directives); the material may still produce health damage following entry through wounds, lesions or abrasions.

Entry into the blood-stream, through, for example, cuts, abrasions or lesions, may produce systemic injury with harmful effects. Examine the skin prior to the use of the material and ensure that any external damage is suitably protected.

Products when wet may be quite alkaline and this alkali action on the skin may contribute to cement contact dermatitis by causing drying and defatting of the skin which may be followed by hardening, cracking, development of lesions, possible infections of lesions and penetration by soluble salts.

##### INHALED

■ Inhalation of vapours or aerosols (mists, fumes), generated by the material during the course of normal handling, may be damaging to the health of the individual.

The material can cause respiratory irritation in some persons. The body's response to such irritation can cause further lung damage.

Persons with impaired respiratory function, airway diseases and conditions such as emphysema or chronic bronchitis, may incur further disability if excessive concentrations of particulate are inhaled.

If prior damage to the circulatory or nervous systems has occurred or if kidney damage has been sustained, proper screenings should be conducted on individuals who may be exposed to further risk if handling and use of the material result in excessive exposures.

Effects on lungs are significantly enhanced in the presence of respirable particles.

##### CHRONIC HEALTH EFFECTS

■ Overexposure to respirable dust may cause coughing, wheezing, difficulty in breathing and impaired lung function. Chronic symptoms may include decreased vital lung capacity, chest infections

Repeated exposures, in an occupational setting, to high levels of fine-divided dusts may produce a condition known as pneumoconiosis which is the lodgement of any inhaled dusts in the lung irrespective of the effect.

This is particularly true when a significant number of particles less than 0.5 microns (1/50,000 inch), are present. Lung shadows are seen in the X-ray. Symptoms of pneumoconiosis may include a progressive dry cough, shortness of breath on exertion (exertional dyspnea), increased chest expansion, weakness and weight loss. As

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 11 of 13

## Section 11 - TOXICOLOGICAL INFORMATION

the disease progresses the cough produces a stringy mucous, vital capacity decreases further and shortness of breath becomes more severe. Other signs or symptoms include altered breath sounds, diminished lung capacity, diminished oxygen uptake during exercise, emphysema and pneumothorax (air in lung cavity) as a rare complication.

Removing workers from possibility of further exposure to dust generally leads to halting the progress of the lung abnormalities. Where worker-exposure potential is high, periodic examinations with emphasis on lung dysfunctions should be undertaken

Dust inhalation over an extended number of years may produce pneumoconiosis.. Pneumoconiosis is the accumulation of dusts in the lungs and the tissue reaction in its presence. It is further classified as being of noncollagenous or collagenous types. Noncollagenous pneumoconiosis, the benign form, is identified by minimal stromal reaction, consists mainly of reticulin fibres, an intact alveolar architecture and is potentially reversible.

Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound. Key criteria for the diagnosis of RADS include the absence of preceding respiratory disease, in a non-atopic individual, with abrupt onset of persistent asthma-like symptoms within minutes to hours of a documented exposure to the irritant. A reversible airflow pattern, on spirometry, with the presence of moderate to severe bronchial hyperreactivity on methacholine challenge testing and the lack of minimal lymphocytic inflammation, without eosinophilia, have also been included in the criteria for diagnosis of RADS. RADS (or asthma) following an irritating inhalation is an infrequent disorder with rates related to the concentration of and duration of exposure to the irritating substance. Industrial bronchitis, on the other hand, is a disorder that occurs as result of exposure due to high concentrations of irritating substance (often particulate in nature) and is completely reversible after exposure ceases. The disorder is characterised by dyspnea, cough and mucus production. There is some evidence that inhaling this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

There is limited evidence that, skin contact with this product is more likely to cause a sensitisation reaction in some persons compared to the general population.

Respiratory sensitisation may result in allergic/asthma like responses; from coughing and minor breathing difficulties to bronchitis with wheezing, gasping.

### TOXICITY AND IRRITATION

■ Not available. Refer to individual constituents.

#### PORTLAND CEMENT:

■ unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.

■ Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound. Key criteria for the diagnosis of RADS include the absence of preceding respiratory disease, in a non-atopic individual, with abrupt onset of persistent asthma-like symptoms within minutes to hours of a documented exposure to the irritant. A reversible airflow pattern, on spirometry, with the presence of moderate to severe bronchial hyperreactivity on methacholine challenge testing and the lack of minimal lymphocytic inflammation, without eosinophilia, have also been included in the criteria for diagnosis of RADS. RADS (or asthma) following an irritating inhalation is an infrequent disorder with rates related to the concentration of and duration of exposure to the irritating substance. Industrial bronchitis, on the other hand, is a disorder that occurs as result of exposure due to high concentrations of irritating substance (often particulate in nature) and is completely reversible after exposure ceases. The disorder is characterised by dyspnea, cough and mucus production.

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet  
Issue Date: 29-Jan-2010  
NC317TCP

CHEMWATCH 5044-43  
Version No:3  
CD 2010/1 Page 12 of 13

---

## Section 12 - ECOLOGICAL INFORMATION

---

Refer to data for ingredients, which follows:

PORTLAND CEMENT:

MAPEI KERACRETE POWDER:

- DO NOT discharge into sewer or waterways.

MAPEI KERACRETE POWDER:

PORTLAND CEMENT:

■ Metal-containing inorganic substances generally have negligible vapour pressure and are not expected to partition to air. Once released to surface waters and moist soils their fate depends on solubility and dissociation in water. Environmental processes (such as oxidation and the presence of acids or bases) may transform insoluble metals to more soluble ionic forms. Microbiological processes may also transform insoluble metals to more soluble forms. Such ionic species may bind to dissolved ligands or sorb to solid particles in aquatic or aqueous media. A significant proportion of dissolved/ sorbed metals will end up in sediments through the settling of suspended particles. The remaining metal ions can then be taken up by aquatic organisms.

When released to dry soil most metals will exhibit limited mobility and remain in the upper layer; some will leach locally into ground water and/ or surface water ecosystems when soaked by rain or melt ice.

Environmental processes may also be important in changing solubilities.

Even though many metals show few toxic effects at physiological pHs, transformation may introduce new or magnified effects.

A metal ion is considered infinitely persistent because it cannot degrade further.

The current state of science does not allow for an unambiguous interpretation of various measures of bioaccumulation.

The counter-ion may also create health and environmental concerns once isolated from the metal. Under normal physiological conditions the counter-ion may be essentially insoluble and may not be bioavailable.

Environmental processes may enhance bioavailability.

---

## Section 13 - DISPOSAL CONSIDERATIONS

---

- Containers may still present a chemical hazard/ danger when empty.
- Return to supplier for reuse/ recycling if possible.

Otherwise:

- If container can not be cleaned sufficiently well to ensure that residuals do not remain or if the container cannot be used to store the same product, then puncture containers, to prevent re-use, and bury at an authorised landfill.
- Where possible retain label warnings and MSDS and observe all notices pertaining to the product.
- Recycle wherever possible.
- Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
- Dispose of by: burial in a land-fill specifically licenced to accept chemical and / or pharmaceutical wastes or Incineration in a licenced apparatus (after admixture with suitable combustible material)
- Decontaminate empty containers. Observe all label safeguards until containers are cleaned and destroyed.

continued...

# MAPEI KERACRETE POWDER

Chemwatch Independent Material Safety Data Sheet

Issue Date: 29-Jan-2010

NC317TCP

CHEMWATCH 5044-43

Version No:3

CD 2010/1 Page 13 of 13

---

## Section 14 - TRANSPORTATION INFORMATION

---

### HAZCHEM:

None (ADG7)

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS: ADG7, UN, IATA, IMDG

---

## Section 15 - REGULATORY INFORMATION

---

### POISONS SCHEDULE

None

### REGULATIONS

Regulations for ingredients

### portland cement (CAS: 65997-15-1) is found on the following regulatory lists;

"Australia Exposure Standards", "Australia High Volume Industrial Chemical List (HVICL)", "Australia Inventory of Chemical Substances (AICS)", "OECD Representative List of High Production Volume (HPV) Chemicals"

**No data for Mapei Keracrete Powder (CW: 5044-43)**

---

## Section 16 - OTHER INFORMATION

---

■ Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

[www.chemwatch.net/references](http://www.chemwatch.net/references).

■ The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

*This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.*

Issue Date: 29-Jan-2010

Print Date: 23-Mar-2010

*This is the end of the MSDS.*



# MAPEI KERACRETE LIQUID

Chemwatch Independent Material Safety Data Sheet  
Issue Date: 25-Feb-2009  
NC317TCP

CHEMWATCH 5042-29  
Version No:4  
CD 2010/1 Page 2 of 9

---

## Section 3 - COMPOSITION / INFORMATION ON INGREDIENTS

---

NAME	CAS RN	%
adhesive base as acrylic resin	Various	Not spec.
fillers, pigments unspecified		Not spec.
water	7732-18-5	Not spec.

No other ingredient information supplied.

---

## Section 4 - FIRST AID MEASURES

---

### SWALLOWED

- Immediately give a glass of water.
- First aid is not generally required. If in doubt, contact a Poisons Information Centre or a doctor.

### EYE

- If this product comes in contact with the eyes:
  - Wash out immediately with fresh running water.
  - Ensure complete irrigation of the eye by keeping eyelids apart and away from eye and moving the eyelids by occasionally lifting the upper and lower lids.
  - Seek medical attention without delay; if pain persists or recurs seek medical attention.
  - Removal of contact lenses after an eye injury should only be undertaken by skilled personnel.

### SKIN

- If skin contact occurs:
  - Immediately remove all contaminated clothing, including footwear.
  - Flush skin and hair with running water (and soap if available).
  - Seek medical attention in event of irritation.

### INHALED

- If fumes or combustion products are inhaled remove from contaminated area.
- Lay patient down. Keep warm and rested.
- Prostheses such as false teeth, which may block airway, should be removed, where possible, prior to initiating first aid procedures.
- Apply artificial respiration if not breathing, preferably with a demand valve resuscitator, bag-valve mask device, or pocket mask as trained. Perform CPR if necessary.
- Transport to hospital, or doctor, without delay.

### NOTES TO PHYSICIAN

- Treat symptomatically.
- 

## Section 5 - FIRE FIGHTING MEASURES

---

### EXTINGUISHING MEDIA

- There is no restriction on the type of extinguisher which may be used.
- Use extinguishing media suitable for surrounding area.

### FIRE FIGHTING

- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves for fire only.
- Prevent, by any means available, spillage from entering drains or water courses.

continued...

# MAPEI KERACRETE LIQUID

Chemwatch Independent Material Safety Data Sheet

Issue Date: 25-Feb-2009

NC317TCP

CHEMWATCH 5042-29

Version No:4

CD 2010/1 Page 3 of 9

Section 5 - FIRE FIGHTING MEASURES

---

- Use fire fighting procedures suitable for surrounding area.
- DO NOT approach containers suspected to be hot.
- Cool fire exposed containers with water spray from a protected location.
- If safe to do so, remove containers from path of fire.
- Equipment should be thoroughly decontaminated after use.

## FIRE/EXPLOSION HAZARD

- Non combustible.
  - Not considered a significant fire risk, however containers may burn.
- May emit poisonous fumes.

## FIRE INCOMPATIBILITY

- None known.

## HAZCHEM

None

## PERSONAL PROTECTION

Glasses:

Chemical goggles.

Gloves:

PVC chemical resistant type.

---

## Section 6 - ACCIDENTAL RELEASE MEASURES

---

### MINOR SPILLS

- Clean up all spills immediately.
- Avoid breathing vapours and contact with skin and eyes.
- Control personal contact by using protective equipment.
- Contain and absorb spill with sand, earth, inert material or vermiculite.
- Wipe up.
- Place in a suitable, labelled container for waste disposal.

### MAJOR SPILLS

- Moderate hazard.
- Clear area of personnel and move upwind.
- Alert Fire Brigade and tell them location and nature of hazard.
- Wear breathing apparatus plus protective gloves.
- Prevent, by any means available, spillage from entering drains or water course.
- Stop leak if safe to do so.
- Contain spill with sand, earth or vermiculite.
- Collect recoverable product into labelled containers for recycling.
- Neutralise/decontaminate residue.
- Collect solid residues and seal in labelled drums for disposal.
- Wash area and prevent runoff into drains.
- After clean up operations, decontaminate and launder all protective clothing and equipment before storing and re-using.
- If contamination of drains or waterways occurs, advise emergency services.

Personal Protective Equipment advice is contained in Section 8 of the MSDS.

continued...

# MAPEI KERACRETE LIQUID

Chemwatch Independent Material Safety Data Sheet  
Issue Date: 25-Feb-2009  
NC317TCP

CHEMWATCH 5042-29  
Version No:4  
CD 2010/1 Page 4 of 9

---

## Section 7 - HANDLING AND STORAGE

---

### PROCEDURE FOR HANDLING

- Avoid all personal contact, including inhalation.
- Wear protective clothing when risk of exposure occurs.
- Use in a well-ventilated area.
- Avoid contact with moisture.
- Avoid contact with incompatible materials.
- When handling, DO NOT eat, drink or smoke.
- Keep containers securely sealed when not in use.
- Avoid physical damage to containers.
- Always wash hands with soap and water after handling.
- Work clothes should be laundered separately. Launder contaminated clothing before re-use.
- Use good occupational work practice.
- Observe manufacturer's storing and handling recommendations.
- Atmosphere should be regularly checked against established exposure standards to ensure safe working conditions are maintained.
- DO NOT allow clothing wet with material to stay in contact with skin.

### SUITABLE CONTAINER

- Polyethylene or polypropylene container.
- Packing as recommended by manufacturer.
- Check all containers are clearly labelled and free from leaks.

### STORAGE INCOMPATIBILITY

- None known.

### STORAGE REQUIREMENTS

- Store in original containers.
- Keep containers securely sealed.
- Store in a cool, dry, well-ventilated area.
- Store away from incompatible materials and foodstuff containers.
- Protect containers against physical damage and check regularly for leaks.
- Observe manufacturer's storing and handling recommendations.

---

### SAFE STORAGE WITH OTHER CLASSIFIED CHEMICALS



+: *May be stored together*

O: *May be stored together with specific preventions*

X: *Must not be stored together*

---

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

---

### EXPOSURE CONTROLS

The following materials had no OELs on our records

- water:

CAS:7732- 18- 5

continued...

# MAPEI KERACRETE LIQUID

Chemwatch Independent Material Safety Data Sheet  
Issue Date: 25-Feb-2009  
NC317TCP

CHEMWATCH 5042-29  
Version No:4  
CD 2010/1 Page 5 of 9

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

### MATERIAL DATA



MAPEI KERACRETE LIQUID:

- None assigned for mixture or identified for ingredient(s).

WATER:

- Not available. Refer to individual constituents.

### PERSONAL PROTECTION

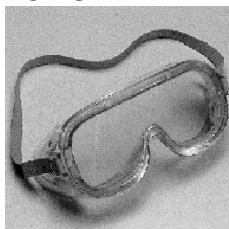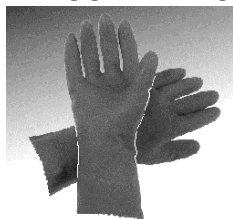

### EYE

- Safety glasses with side shields.
- Chemical goggles.
- Contact lenses may pose a special hazard; soft contact lenses may absorb and concentrate irritants. A written policy document, describing the wearing of lens or restrictions on use, should be created for each workplace or task. This should include a review of lens absorption and adsorption for the class of chemicals in use and an account of injury experience. Medical and first-aid personnel should be trained in their removal and suitable equipment should be readily available. In the event of chemical exposure, begin eye irrigation immediately and remove contact lens as soon as practicable. Lens should be removed at the first signs of eye redness or irritation - lens should be removed in a clean environment only after workers have washed hands thoroughly. [CDC NIOSH Current Intelligence Bulletin 59].

### HANDS/FEET

- Wear chemical protective gloves, eg. PVC.
- Wear safety footwear or safety gumboots, eg. Rubber.

### OTHER

- Overalls.
- P.V.C. apron.
- Barrier cream.
- Skin cleansing cream.
- Eye wash unit.

The local concentration of material, quantity and conditions of use determine the type of personal protective equipment required. For further information consult site specific CHEMWATCH data (if available), or your Occupational Health and Safety Advisor.

### ENGINEERING CONTROLS

- General exhaust is adequate under normal operating conditions. Local exhaust ventilation may be required in special circumstances. If risk of overexposure exists, wear approved respirator. Supplied-air type respirator may be required in special circumstances. Correct fit is essential to ensure adequate protection. Provide adequate ventilation in warehouses and enclosed storage areas. Air contaminants generated in the workplace possess varying "escape" velocities which, in turn, determine the "capture velocities" of fresh circulating air required to effectively remove the contaminant.

continued...

# MAPEI KERACRETE LIQUID

Chemwatch Independent Material Safety Data Sheet

Issue Date: 25-Feb-2009

NC317TCP

CHEMWATCH 5042-29

Version No:4

CD 2010/1 Page 6 of 9

## Section 8 - EXPOSURE CONTROLS / PERSONAL PROTECTION

Type of Contaminant: solvent, vapours, degreasing etc., evaporating from tank (in still air). aerosols, fumes from pouring operations, intermittent container filling, low speed conveyer transfers, welding, spray drift, plating acid fumes, pickling (released at low velocity into zone of active generation) direct spray, spray painting in shallow booths, drum filling, conveyer loading, crusher dusts, gas discharge (active generation into zone of rapid air motion) grinding, abrasive blasting, tumbling, high speed wheel generated dusts (released at high initial velocity into zone of very high rapid air motion)	Air Speed: 0.25- 0.5 m/s (50- 100 f/min)  0.5- 1 m/s (100- 200 f/min.)  1- 2.5 m/s (200- 500 f/min.)  2.5- 10 m/s (500- 2000 f/min.)
--	---

Within each range the appropriate value depends on:

Lower end of the range

1: Room air currents minimal or favourable to capture

2: Contaminants of low toxicity or of nuisance value only.

3: Intermittent, low production.

4: Large hood or large air mass in motion

Upper end of the range

1: Disturbing room air currents

2: Contaminants of high toxicity

3: High production, heavy use

4: Small hood- local control only

Simple theory shows that air velocity falls rapidly with distance away from the opening of a simple extraction pipe. Velocity generally decreases with the square of distance from the extraction point (in simple cases). Therefore the air speed at the extraction point should be adjusted, accordingly, after reference to distance from the contaminating source. The air velocity at the extraction fan, for example, should be a minimum of 1-2 m/s (200-400 f/min) for extraction of solvents generated in a tank 2 meters distant from the extraction point. Other mechanical considerations, producing performance deficits within the extraction apparatus, make it essential that theoretical air velocities are multiplied by factors of 10 or more when extraction systems are installed or used.

## Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

### APPEARANCE

White liquid with a characteristic odour; miscible with water.

### PHYSICAL PROPERTIES

Liquid.

Mixes with water.

State	Liquid	Molecular Weight	Not applicable
Melting Range (°C)	Not available	Viscosity	Not Available
Boiling Range (°C)	100	Solubility in water (g/L)	Miscible
Flash Point (°C)	Non Flammable	pH (1% solution)	Not available

continued...

# MAPEI KERACRETE LIQUID

Chemwatch Independent Material Safety Data Sheet

Issue Date: 25-Feb-2009

NC317TCP

CHEMWATCH 5042-29

Version No:4

CD 2010/1 Page 7 of 9

## Section 9 - PHYSICAL AND CHEMICAL PROPERTIES

Decomposition Temp (°C)	Not available	pH (as supplied)	11
Autoignition Temp (°C)	Not applicable	Vapour Pressure (kPa)	Not available
Upper Explosive Limit (%)	Not applicable	Specific Gravity (water=1)	1.02
Lower Explosive Limit (%)	Not applicable	Relative Vapour Density (air=1)	Not available
Volatile Component (%vol)	Not available	Evaporation Rate	Slow

## Section 10 - CHEMICAL STABILITY AND REACTIVITY INFORMATION

### CONDITIONS CONTRIBUTING TO INSTABILITY

- Presence of incompatible materials.
- Product is considered stable.
- Hazardous polymerisation will not occur.

*For incompatible materials - refer to Section 7 - Handling and Storage.*

## Section 11 - TOXICOLOGICAL INFORMATION

### POTENTIAL HEALTH EFFECTS

#### ACUTE HEALTH EFFECTS

##### SWALLOWED

■ The material has NOT been classified by EC Directives or other classification systems as "harmful by ingestion". This is because of the lack of corroborating animal or human evidence. The material may still be damaging to the health of the individual, following ingestion, especially where pre-existing organ (eg. liver, kidney) damage is evident. Present definitions of harmful or toxic substances are generally based on doses producing mortality rather than those producing morbidity (disease, ill-health). Gastrointestinal tract discomfort may produce nausea and vomiting. In an occupational setting however, ingestion of insignificant quantities is not thought to be cause for concern.

##### EYE

■ This material can cause eye irritation and damage in some persons.

##### SKIN

■ This material can cause inflammation of the skin on contact in some persons. The material may accentuate any pre-existing dermatitis condition.

##### INHALED

■ The material can cause respiratory irritation in some persons. The body's response to such irritation can cause further lung damage.

#### CHRONIC HEALTH EFFECTS

■ Asthma-like symptoms may continue for months or even years after exposure to the material ceases. This may be due to a non-allergenic condition known as reactive airways dysfunction syndrome (RADS) which can occur following exposure to high levels of highly irritating compound. Key criteria for the diagnosis of RADS include the absence of preceding respiratory disease, in a non-atopic individual, with abrupt onset of persistent asthma-like symptoms within minutes to hours of a documented exposure to the irritant. A reversible airflow pattern, on spirometry, with the presence of moderate to severe bronchial hyperreactivity on methacholine challenge testing and the lack of minimal lymphocytic inflammation, without eosinophilia, have also been included in the criteria for diagnosis of RADS. RADS (or asthma) following an irritating inhalation is an infrequent disorder with rates related to the concentration of and duration of exposure to

continued...

# MAPEI KERACRETE LIQUID

Chemwatch Independent Material Safety Data Sheet  
Issue Date: 25-Feb-2009  
NC317TCP

CHEMWATCH 5042-29  
Version No:4  
CD 2010/1 Page 8 of 9

## Section 11 - TOXICOLOGICAL INFORMATION

the irritating substance. Industrial bronchitis, on the other hand, is a disorder that occurs as result of exposure due to high concentrations of irritating substance (often particulate in nature) and is completely reversible after exposure ceases. The disorder is characterised by dyspnea, cough and mucus production.

### TOXICITY AND IRRITATION

- unless otherwise specified data extracted from RTECS - Register of Toxic Effects of Chemical Substances.
- Not available for mixture or identified for ingredient(s).

## Section 12 - ECOLOGICAL INFORMATION

Refer to data for ingredients, which follows:

MAPEI KERACRETE LIQUID:

- DO NOT discharge into sewer or waterways.

### Ecotoxicity

Ingredient	Persistence: Water/Soil	Persistence: Air	Bioaccumulation	Mobility
water	LOW		LOW	HIGH

## Section 13 - DISPOSAL CONSIDERATIONS

- Recycle wherever possible.
- Consult manufacturer for recycling options or consult local or regional waste management authority for disposal if no suitable treatment or disposal facility can be identified.
- Dispose of by: burial in a land-fill specifically licenced to accept chemical and / or pharmaceutical wastes or incineration in a licenced apparatus (after admixture with suitable combustible material).
- Decontaminate empty containers. Observe all label safeguards until containers are cleaned and destroyed.

## Section 14 - TRANSPORTATION INFORMATION

### HAZCHEM:

- None (ADG7)

NOT REGULATED FOR TRANSPORT OF DANGEROUS GOODS: ADG7, UN, IATA, IMDG

## Section 15 - REGULATORY INFORMATION

### POISONS SCHEDULE

None

### REGULATIONS

Regulations for ingredients

continued...

# MAPEI KERACRETE LIQUID

Chemwatch Independent Material Safety Data Sheet

Issue Date: 25-Feb-2009

NC317TCP

CHEMWATCH 5042-29

Version No:4

CD 2010/1 Page 9 of 9

Section 15 - REGULATORY INFORMATION

**water (CAS: 7732-18-5) is found on the following regulatory lists;**

"Australia Inventory of Chemical Substances (AICS)", "IMO IBC Code Chapter 18: List of products to which the Code does not apply", "OECD Representative List of High Production Volume (HPV) Chemicals"

**No data for Mapei Keracrete Liquid (CW: 5042-29)**

No data for acrylic resin (CAS: , Various)

## Section 16 - OTHER INFORMATION

### MSDS SECTION CHANGES

*The following table displays the version number of and date on which each section was last changed.*

Section Name	Version	Date	Section Name	Version	Date	Section Name	Version	Date
Advice to Doctor	4	25- Feb- 2009	Storage (storage incompatibility)	4	25- Feb- 2009	Acute Health (inhaled)	4	25- Feb- 2009
First Aid (eye)	4	25- Feb- 2009	Storage (storage requirement)	4	25- Feb- 2009	Acute Health (skin)	4	25- Feb- 2009
First Aid (skin)	4	25- Feb- 2009	Exposure Standard	4	25- Feb- 2009	Acute Health (swallowed)	4	25- Feb- 2009
First Aid (swallowed)	4	25- Feb- 2009	Personal Protection (hands/feet)	4	25- Feb- 2009	Chronic Health	4	25- Feb- 2009
Fire Fighter (extinguishing media)	4	25- Feb- 2009	Appearance	4	25- Feb- 2009	Toxicity and Irritation (Other)	4	25- Feb- 2009
Spills (major)	4	25- Feb- 2009	19	4	25- Feb- 2009	Environmental	4	25- Feb- 2009
Handling Procedure	4	25- Feb- 2009	Acute Health (eye)	4	25- Feb- 2009	Disposal	4	25- Feb- 2009

■ Classification of the preparation and its individual components has drawn on official and authoritative sources as well as independent review by the Chemwatch Classification committee using available literature references.

A list of reference resources used to assist the committee may be found at:

[www.chemwatch.net/references](http://www.chemwatch.net/references).

■ The (M)SDS is a Hazard Communication tool and should be used to assist in the Risk Assessment. Many factors determine whether the reported Hazards are Risks in the workplace or other settings. Risks may be determined by reference to Exposures Scenarios. Scale of use, frequency of use and current or available engineering controls must be considered.

*This document is copyright. Apart from any fair dealing for the purposes of private study, research, review or criticism, as permitted under the Copyright Act, no part may be reproduced by any process without written permission from CHEMWATCH. TEL (+61 3) 9572 4700.*

Issue Date: 25-Feb-2009

Print Date: 23-Mar-2010

*This is the end of the MSDS.*